

Work Order ID 69981

Wednesday, May 25, 2011 9:08:17 AM



Page 1

Item ID: D206-667-147TRN

Accept



Setup Start



Revision ID:

Stop



Item Name: Crosstube Assembly, Mid Fwd

Start Date: 5/25/2011 Start Qty: 1.00



Cust Item ID:

Required Date: 6/30/2011 Req'd Qty: 1.00



Customer:

Reference:

Approvals: Process Plan: R Date: 1-05-25

Tooling:

Date:

Run Start



QC: _____

Date:

SPC (Y/N): _____

Date:

Stop



Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
Draw Nbr	Revision Nbr								
D206-667-147	A								

100

0.00



Mori Seiki

MORI SEIKI CNC LATHE LARGE

Memo

0.00

Mori Seiki CNC Lathe Large

1-Fill tube with sand & install plugs DTxxxx on both ends as per Folio FB029
2-Turn first side as per Folio FB029
3-File down transition lines smooth.

MM.L 11/06/20

110

QC1- Inspect dimensions to dimension sheet

0.00



QC

Memo

0.00

Quality Control

MM.L 11/06/21

120

0.00



Mori Seiki

MORI SEIKI CNC LATHE LARGE

Memo

0.00

Mori Seiki CNC Lathe Large

1-Turn second side as per Folio FB029
2-File down transition lines smooth.
3-Remove sand and plugs

MM.L 11/06/21

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries .

Work Order ID 69981

Wednesday, May 25, 2011 9:08:18 AM

Page 2

Item ID: D206-667-147TRN

Accept

Setup Start

Revision ID:

Stop

Item Name: Crosstube Assembly, Mid Fwd

Start Date: 5/25/2011 Start Qty: 1.00

Cust Item ID:

Required Date: 6/30/2011 Req'd Qty: 1.00

Customer:




Reference:

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____

Run Start

QC: _____ Date: _____ SPC (Y/N): _____ Date: _____

Stop

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
130  QC Quality Control	QC1- Inspect dimensions to dimension sheet Memo	0.00 0.00		<i>and 11/06/21</i>		<i>1</i>	<i>0</i>		
140  QC Quality Control	QC8- Inspect parts - second check Memo	0.00 0.00		<i>SL 11/06/21</i>					
150  HandFXtube Hand Finishing Crosstubes	Crosstubes Chemical Conversion Memo	0.00 0.00		<i>SAD JW 11/06/24</i>					

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Work Order ID 69981

Wednesday, May 25, 2011 9:08:18 AM

Page 3

Item ID: D206-667-147TRN

Accept

Setup Start

Revision ID:

Stop

Item Name: Crosstube Assembly, Mid Fwd

Start Date: 5/25/2011 Start Qty: 1.00

Cust Item ID:

Required Date: 6/30/2011 Req'd Qty: 1.00

Customer:

Reference:

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____

Run Start

QC: _____ Date: _____ SPC (Y/N): _____ Date: _____

Stop

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
--------------------------------	--------------------------	----------------------	---------	--------	--------------	---------------	---------------	------------------	----------------

160

QC3- Inspect Part Finish

0.00



QC

Memo

0.00

Quality Control

SAD
11-06-23

①

170

Packaging

0.00



Packaging

Memo

0.00

Packaging

Identify and stock in kanban rack
Location: LANDING
Gear

SAD
11-06-23

①

180

QC21- Final Inspection - Work Order Release

0.00



QC

Memo

0.00

Quality Control

11-06-27
JMF
11-06-24

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Picklist Print

Wednesday, May 25, 2011 9:08:25 AM

Page 1

Work Order ID: 69981



Parent Item: D206-667-147TRN



Parent Item Name: Crosstube Assembly, Mid Fwd

Start Date: 5/25/2011

Required Date: 6/30/2011

Start Qty: 1.00

Required Qty: 1.00

Comments: IPP rev:A 11.01.06 new issue DD verf:EC

Component Item ID/ Item Name	Replacement Item ID	Mfg/ Purch	Bin Item	Primary Location	Last Location	Route Seq ID	Unit of Measure	Qty on Hand	Qty per Kit	Total Qty	Qty Issued	Date Issued	Status
---------------------------------	------------------------	---------------	-------------	---------------------	------------------	-----------------	--------------------	----------------	-------------	--------------	---------------	----------------	--------

D6002-115

Manufactured

No

100

Each

31.0000

1

1



Crosstube Material

Location

Loc Qty

Loc Code

LG

31

34684

1

34776

30

9mm/l 11/06/20

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

DART AEROSPACE LTD		Work Order: 6928.1
Description: Crosstube Assembly		Part Number: D206-66747
Inspection Dwg:	Rev: 4	Page 1 of 1

FIRST ARTICLE INSPECTION CHECKLIST

Inspection Sheet	Drawing Dimension	Tolerance	Actual Dimension	Accept	Reject	Method of Inspection	Comments
SIDE A	2.240	+0.005	2.241	✓		Vern	JF-01
	1.984	+0.005	1.984	✓		"	
	2.019	+0.005	2.021	✓		"	
	2.058	+0.005	2.063	✓		"	
	2.097	+0.005	2.101	✓		"	
	2.136	+0.005	2.141	✓		"	
	2.176	+0.005	2.181	✓		"	
	0.125	±0.010	0.130	✓		Vern	JF-01
	4.438	±0.030	4.438	✓		"	
	R0.063	±0.010	0.063	✓		RG	
	R2.00	±0.010	2.00	✓		"	
	R0.063	±0.010	0.063	✓		"	
SIDE B	2.240	+0.005	2.244	✓		Vern	JF-01
	1.984	+0.005	1.984	✓		"	
	2.014	+0.005	2.023	✓		"	
	2.058	+0.005	2.063	✓		"	
	2.097	+0.005	2.102	✓		"	
	2.136	+0.005	2.141	✓		"	
	2.176	+0.005	2.181	✓		"	
	0.125	±0.010	0.130	✓		Vern	JF-01
	4.438	±0.030	4.440	✓		"	
	R0.063	±0.010	0.063	✓		RG	
	R2.00	±0.010	2.00	✓		"	
	R0.063	±0.010	0.063	✓		"	
	99.84	±0.020	99.84	✓		Tape	MM1-02

Measured by: gmm, lmk	Audited by: J	Preliminary Approval:
Date: 11/06/20	Date: 11/06/21	Date:

Rev	Date	Change	Revised by	Approved
B	10.04.14	Added preliminary approval	KJ	

10.04.15

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Item	Qty -147	Part Number	Description
1	X	D206-667-147	CROSSTUBE ASSEMBLY (206L MID FWD)
2	1	D6002-115	CROSSTUBE
3	2	D2873-043	NUT PLATE
4	2	D2873-045	NUT PLATE
5	2	D2891-1	SUPPORT
6	4	D3595-063-395	RUBBER CUSHION
7	4	MS21920-20	CLAMP (OR MS21920-21)
8	14	MS20601AD4W8	RIVET (OR NAS9302B-4-8)
9	A/R	MAGNOBOND 6398	ROCKWELL SPECIFICATION RBO-120-023 ADHESIVE (TEXTRON/BELL SPEC. 299- 947-100, TYPE II, CLASS 2 ADHESIVE)

GENERAL NOTES:

- 1) MATERIAL: MANUFACTURED FROM D6002-115
FINISHED LENGTH = 99.84±0.020
- 2) FINISH: CHEMICAL CONVERSION COAT PER DART QSI 005 4.1
PRIME INSIDE AND OUTSIDE PER DART QSI 005 4.2
PAINT OUTSIDE PER DART QSI 005 4.2
- 3) TOLERANCES ARE PER DART QSI 018 UNLESS OTHERWISE NOTED.
- 4) UNITS: INCHES UNLESS OTHERWISE NOTED.
- 5) BREAK SHARP EDGES: 0.005 TO 0.010 MAX.
- 6) IDENTIFICATION: SCRIBE DART PART NUMBER "D206-667-147" AND BATCH NUMBER ON
INSIDE OF CUFF PER DART QSI 044 6.4 (VIBRATING STYLUS).
- 7) WEIGHT: 15.0 lbs (-507 = 12.84)
- 8) PART IS SYMMETRIC ABOUT CENTERLINE.
- 9) RUN CUTTER OFF PART WHERE INDICATED. BLEND OUT EDGE LONGITUDINALLY,
TRANSITION SHOULD BE SMOOTH.
- 10) BEND PROGRESSIVELY WITH A MINIMUM OF 10 PASSES. MAXIMUM TUBE FLATTENING DUE
TO BENDING IS 6% BASED ON O.D.
- 11) LIQUID PENETRANT INSPECT OUTSIDE SURFACE OF CROSSTUBE PER QSI 038.
- 12) INSTALL D2891-1 SUPPORT USING 0.03" TO 0.06" THICK LAYER OF MAGNOBOND 6398 PER QSI
015. LET CURE FOR 12 HOURS AFTER INSTALLATION AND PRIOR TO PACKAGING.
- 13) INSTALL MS21920-20 CLAMPS (OR -21) WITH D3595-063-395 RUBBER CUSHIONS TO SECURE
THE D2891-1 SUPPORT ON TOP SIDE OF THE CROSSTUBE. ENSURE CLAMP MECHANISMS
ARE LOCATED ON CROSSTUBE SUPPORTS.
- 14) EXTREME CARE MUST BE TAKEN TO PROTECT THE OUTSIDE SURFACE OF THE TUBE. THE
OUTSIDE SURFACE MUST BE SMOOTH AND FREE FROM SURFACE DEFECTS SUCH AS
SCRATCHES, NICKS, OR DENTS. DEFECTS UP TO 0.005" MAY BE BLENDED OUT
LONGITUDINALLY. CIRCUMFERENTIAL GRIND MARKS ARE UNACCEPTABLE.
- 15) TORQUE CLAMPS 80 TO 100 IN-LB. ENSURE AT LEAST 1.5 THREADS ARE SHOWING IN
SAFETY AND THAT NUT HAS NOT BOTTOMED-OUT AFTER TORQUING.

SHOP COPY
RETURN TO
ENGINEERING
UNCONTROLLED COPY
SUBJECT TO AMENDMENT
WITHOUT NOTICE
WORK ORDER
NO. 169981

11/05/25

RELEASED
2011-05-25
JW

A	NEW ISSUE	CP	10.11.23
REV.	DESCRIPTION	BY	DATE
DESIGN			
DRAWN			
CHECKED			
MFG. APPR.			
APPROVED			
DE APPR.			
DATE	10.12.23		

DART AEROSPACE LTD HAWKESBURY, ONTARIO, CANADA	
DRAWING NO. D206-667-147	REV. A SHEET 1 OF 4
TITLE CROSSTUBE ASSY (206L MID FWD)	SCALE NTS
COPYRIGHT © 2010 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSES OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.	

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector


Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			


NOTE: Date & initial all entries

8 7 6 5 4 3 2 1

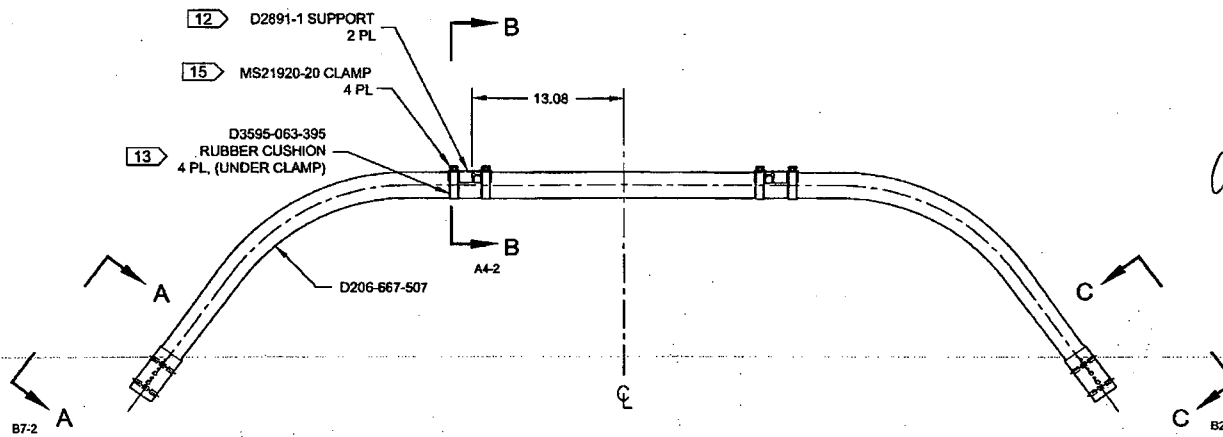


D206-667-147
ASSEMBLY DETAIL
(VIEW LOOKING FWD)


RELEASED
2011-05-24

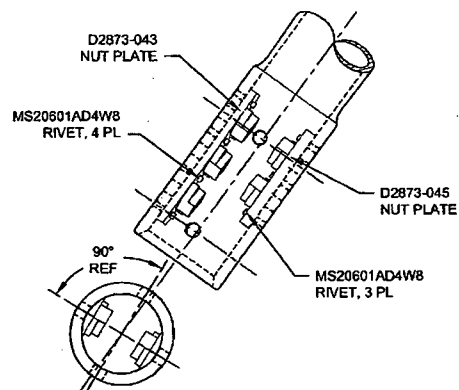

VIEW A-A:
CUFF DETAIL
SCALE 4X

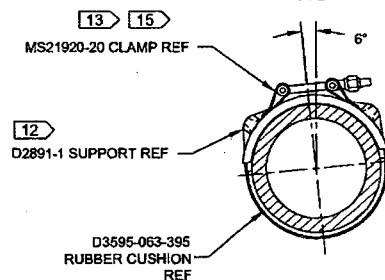

SECTION B-B
SCALE 5X

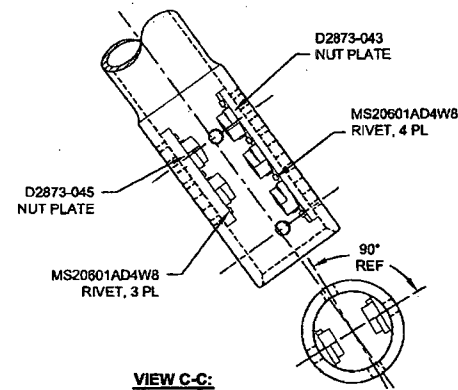

VIEW C-C:
CUFF DETAIL
SCALE 4X

DESIGN	99	DART AEROSPACE LTD	
DRAWN	99	HAWKESBURY, ONTARIO, CANADA	
CHECKED	99	DRAWING NO.	REV. A
MFG. APPR.	99	D206-667-147	SHEET 2 OF 4
APPROVED	99	TITLE	SCALE
DE APPR.	99	CROSSTUBE ASS'Y (206L MID FWD)	NTS
DATE	10.12.23	<small>COPYRIGHT © 2010 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.</small>	

8 7 6 5 4 3 2 1

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries



DESIGN		DART AEROSPACE LTD HAWKESBURY, ONTARIO, CANADA DRAWING NO. D206-667-147 TITLE CROSSTUBE ASS'Y (206L MID FWD) COPYRIGHT © 2010 BY DART AEROSPACE LTD THIS DOCUMENT IS PROVIDED AS ADVISORY AND IS SUPPLIED ON THE UNDERSTANDING THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR REPRODUCED OR COMMERCIALIZED IN ANY OTHER FORMER PERSONS WITHOUT PERMISSION FROM DART AEROSPACE LTD.	REV. A
DRAWN			SHEET 3 OF 4
CHECKED			
MFG. APPR.			
APPROVED			
DE APPR.			NTS
DATE	10.12.23		

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector


Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

8 7 6 5 4 3 2 1

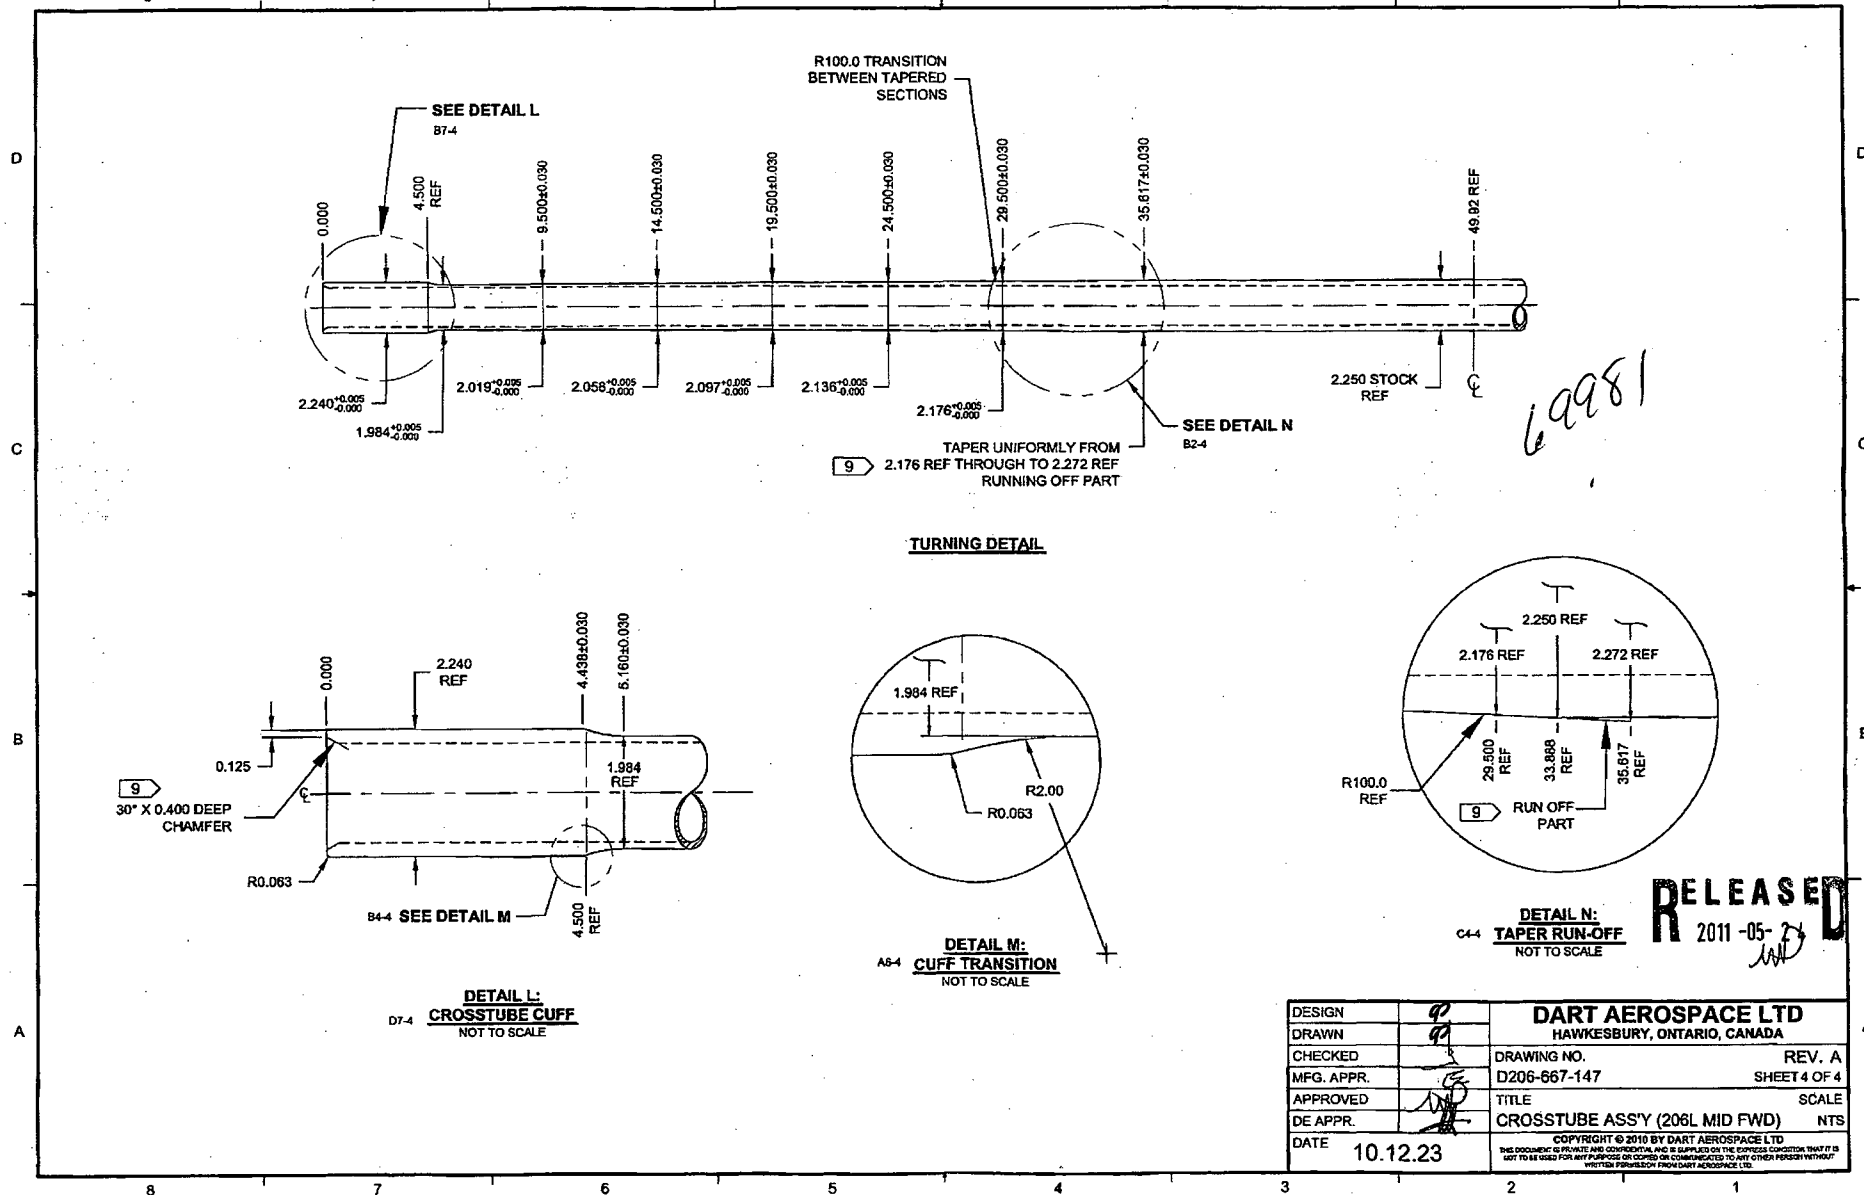

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries